

FLUKE®

771

Milliamp Process Clamp Meter

Calibration Manual

November 2007

© 2007 Fluke Corporation, All rights reserved. Printed in USA. Product specifications are subject to change without notice.
All product names are trademarks of their respective companies.

Table of Contents

Title	Page
Introduction.....	1
Contacting Fluke.....	2
Safety Information	2
Symbols	3
Specifications.....	4
Getting Acquainted with the Meter.....	5
Maintenance.....	6
Cleaning the Meter	6
Battery Replacement	6
Performance Tests.....	8
Required Equipment.....	8
Testing the Batteries	8
Testing the Display.....	9
Display Hold Test.....	9
Backlight Test.....	9
Spotlight LED Test.....	9
Zero Test.....	9
Accuracy Tests	9
Calibration Adjustment.....	11
Adjustment Subroutines	11
Front Panel Operation for Adjustment	11
Calibration Error Messages	12
Calibration Adjustment Procedure	12
Temperature Adjustment Procedure.....	13
Low Range Adjustment Procedure.....	13
High Range Adjustment Procedure	13
Phase Adjustment Procedure	14
User Replaceable Parts	15

List of Tables

Table	Title	Page
1.	Symbols.....	3
2.	Required Equipment.....	8
3.	Accuracy Tests	10
4.	Error Messages.....	12
5.	Replaceable Parts	15

List of Figures

Figure	Title	Page
1.	The 771 Milliamp Process Clamp Meter	5
2.	Changing the Batteries	7
3.	Display Test	9
4.	Accessing the Calibration Button.....	12
5.	Phase Adjustment.....	14
6.	Replaceable Parts	16

771 Milliamp Process Clamp Meter

Introduction

Warning

To avoid electric shock or personal injury, do not perform the calibration verification tests or calibration procedures described in this manual unless you are qualified to do so. The information provided in this manual is for the use of qualified personnel only.

This manual provides the complete verification and adjustment procedure for the 771 Milliamp Process Clamp Meter (referred to in this manual as the Meter). The Meter allows closed-case calibration using reference sources. It measures the reference signals, calculates the correction factors, and stores them in memory. The instrument should be calibrated after repair, or if it fails a performance test.

The *771 Calibration Manual* provides the following information:

- Precautions and safety information
- Specifications
- Basic maintenance
- Calibration verification procedure
- Replaceable parts and accessories

For complete operating instructions, refer to the *771 Instruction Sheet*.

Safety Information

In this manual, a **Warning** identifies conditions and actions that pose hazard(s) to the user. A **Caution** identifies conditions and actions that may damage the test instrument.

The design and manufacture of the device conforms to the latest state of technology and the safety standards specified in IEC 61010-1/ 2nd edition. If used improperly, there is a risk of damage to persons and property.

⚠⚠ Warning

To avoid possible electric shock or personal injury, follow these guidelines:

- **Read this manual before use and follow all safety instructions.**
- **Use the Meter only as specified in this manual; otherwise, the Meter's safety features may be impaired.**
- **Before each use inspect Meter and cable for damage. Look for cracks and missing portions of the clamp and cable. Do not use if clamp is damaged.**
- **Use caution when working with voltages above 33 V rms 47 V peak or 70 V dc these voltages pose a shock hazard.**
- **Do not use to measure ac current.**
- **Do not use to measure dc mA in circuits carrying more than 300 V CAT II.**
- **Avoid working alone so assistance can be rendered in an emergency.**
- **Use extreme caution when working around bare conductors or bus bars. Contact with the conductor could result in electric shock.**
- **To avoid false readings that can lead to electrical shock and injury, replace the batteries as soon as the low battery indicator (🔋) appears.**
- **Adhere to local and national safety codes. Individual protective equipment must be used to prevent shock and arc blast injury where hazardous live conductors are exposed.**

- When measuring, keep fingers behind the Tactile Barrier. See Figure 1.
- Not for use with non-insulated conductors.

⚠ Caution

To avoid damage to the Meter, do not open the Meter for cleaning. Do not use solvents to clean it, and do not immerse it in liquid.

Symbols

Table 1 explains the symbols that are used on the Meter or in this manual.

Table 1. Symbols

	Do not apply around, or remove from HAZARDOUS LIVE conductors
	Risk of danger. Important information. See Users Manual.
	Risk of Electrical Shock
	Equipment protected by double or reinforced insulation
	Battery
	Low Battery
	Conforms to relevant European Union directives
	DC (Direct Current)
	Do not dispose of this product as unsorted municipal waste. Go to Fluke's web site for recycling information.
 N10140	Conforms to relevant Australian standards
 C US	Conforms to relevant Canadian and US standards
CAT II 300 V	Equipment is designed to protect against transients in equipment in fixed-equipment installations, such as distribution panels, feeders and short branch circuits, and lighting systems in large buildings.

Specifications

Current Ranges	±20.99 mA	±21.0 mA - ±99.9 mA
Resolution	0.01 mA	0.1 mA
Accuracy		
20.99 mA range	0.2 % reading ±5 digits	
99.9 mA range	1 % reading ±5 digits	
Maximum Reading	±99.9 mA	
Influence of Earth's Field	< 0.20 mA	
Battery	2 AA 1.5 V Alkaline, IEC LR6	
Working hours	45 hours	
Size (H X W X L)	59 mm x 38 mm x 212 mm (2.32 in x 1.49 in x 8.34 in) (with clamp nested)	
Weight	260 g (9.17 oz) (Including battery)	
Operating Temperature	-10 to 50 °C (14 to 122 °F)	
Storage Temperature	-25 to 70 °C (-13 to 158 °F)	
Operating Humidity	< 90 % @ <30 °C (86 °F) <75 % @ 30 to 50 °C (86 to 122 °F)	
Operating Altitude	0 to 2000 m (1.24 miles)	
Storage Altitude	None	
IP Rating	IP 40	
Vibration Requirements	Random 2 g, 5 to 500 Hz	
EMI, RFI, EMC	Meets all applicable requirements in EN 61326-1	
Temperature Coefficients	0.1x(specified accuracy)/°C (< 18 °C or > 28 °C)	
Measurement Category	IEC 61010-1 61010-2-032 CAT II 300 V CAT II Equipment is designed to protect against transients from energy-consuming equipment supplied from the fixed installation, such as TVs, PCs, portable tools, and other household appliances.	
Agency Approvals	   FCC N10140	

Getting Acquainted with the Meter

Figure 1 shows the Meter functions and features.

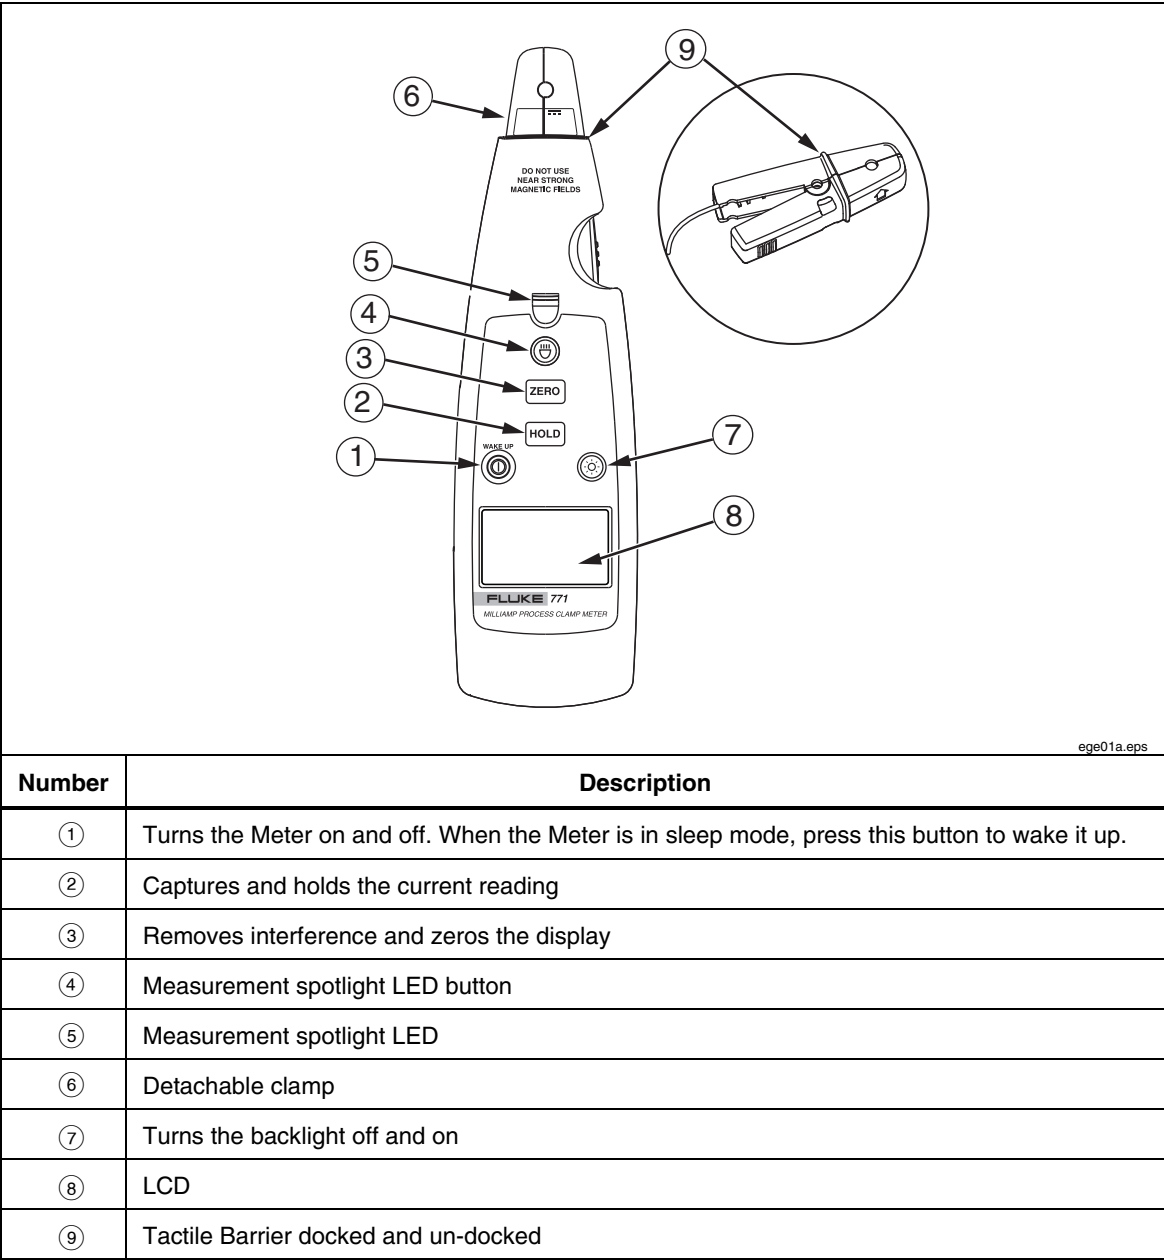


Figure 1. The 771 Milliamp Process Clamp Meter

Maintenance

⚠ ⚠ Warning

To avoid possible electric shock or personal injury, repairs or servicing not covered in this manual should be performed only by qualified personnel.

Cleaning the Meter

⚠ ⚠ Warning

To avoid electrical shock, remove any input signals before cleaning.

⚠ Caution

To avoid damaging the Meter, do not use aromatic hydrocarbons or chlorinated solvents for cleaning. These solutions will react with the plastics used in the Meter.

Clean the instrument case with a damp cloth and mild detergent.


Battery Replacement

⚠ ⚠ Warning

To avoid false readings, that could lead to possible electric shock or personal injury, replace the battery as soon as the low battery indicator (⚡) appears.

To replace the batteries, see Figure 2:

1. Turn the Meter off.
2. Use a flat head screwdriver to loosen the battery access door fastener, and remove the door from the case bottom.
3. Remove the batteries.
4. Replace the batteries with two new AA batteries.
5. Reattach the battery access door to the case bottom and tighten the fastener.

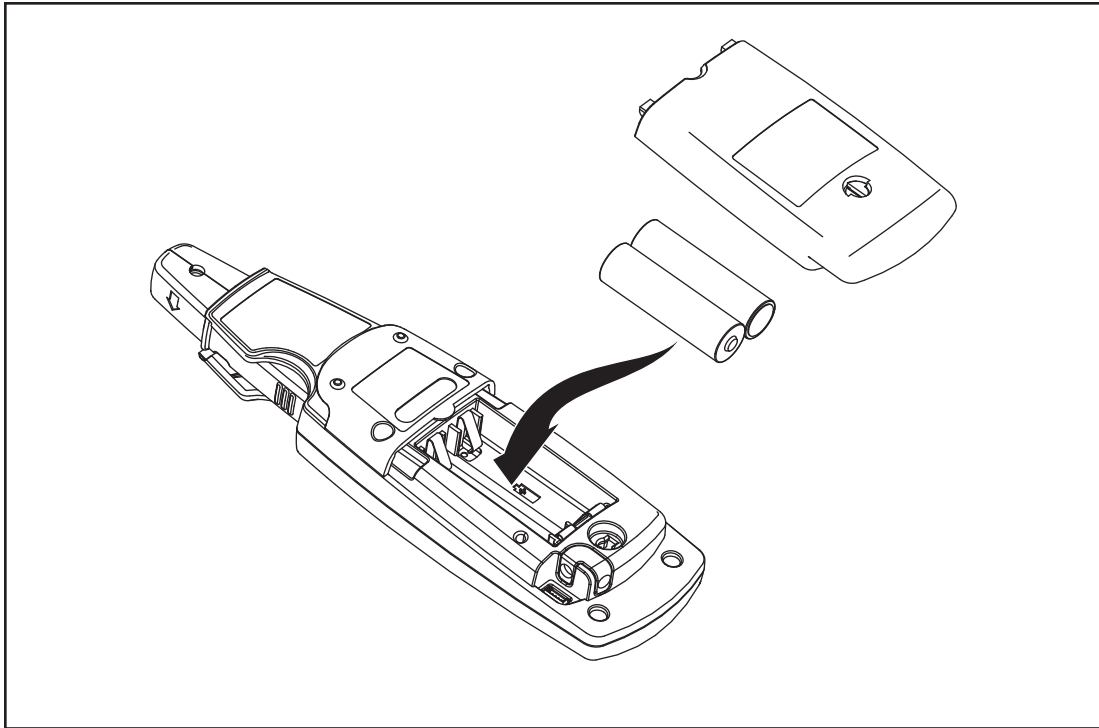

ege02.eps

Figure 2. Changing the Batteries

Performance Tests

Warning

To avoid electrical shock, personal injury, or fire:

- Do not perform the verification tests or calibration adjustment described in this manual unless you are qualified to do so.
- Repairs or servicing should be performed only by qualified personnel.

The following tests are used to verify the functions of the Meter. If the Meter fails any of the verification tests, repair is necessary. For service, see Contacting Fluke.

Required Equipment

Required equipment for the performance tests is listed in Table 2. If the recommended models are not available, equipment with equivalent specifications may be used.

Table 2. Required Equipment

Equipment	Minimum Required Characteristics	Recommended Model
Calibrator	DC Current Accuracy: Range: 20.99 mA = 0.11 % 99.9 mA = 0.375 %	5520A or equivalent
1 loop insulated copper wire	Insulated 18 gauge, minimum, copper wire, 6 inch diameter	

Testing the Batteries

Prior to performing the following tests, check the batteries with a multimeter and replace as necessary. See Battery Replacement.

Testing the Display

1. Press and hold **ZERO** while powering on the Meter.
2. Compare the Meter display to Figure 3.
3. Check all display segments for clarity and contrast.

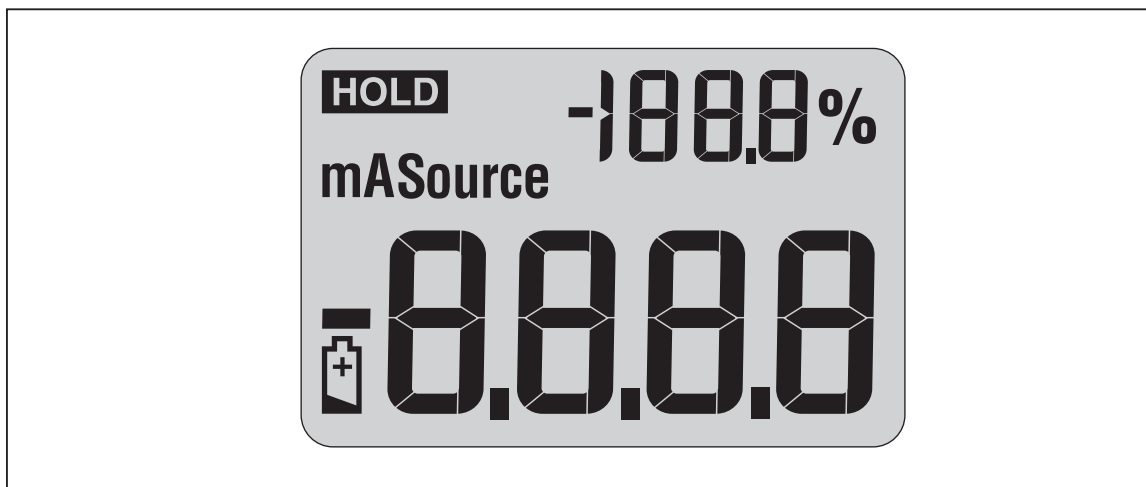


Figure 3. Display Test

fdp1.eps

Display Hold Test

1. Power on the Meter and allow time for the normal operating display to appear.
2. Press **HOLD** and observe that **HOLD** appears on the display. **HOLD** flashes at 3 to 4 second intervals.

Backlight Test

1. Power on the Meter and allow time for the normal operating display to come up.
2. Press  and observe that the backlight comes on.

Spotlight LED Test

1. Power on the Meter and allow time for the normal operating display to come up.
2. Press  and observe that the spotlight LED comes on.

Zero Test

1. Power on the Meter and allow time for the normal operating display to come up.
2. Press **ZERO**. The main display momentarily reads **0.00**, and the percentage scale momentarily reads **-25.0%**.

Accuracy Tests

Accuracy specifications are valid for 1 year after calibration when measured at an operation temperature of 18 °C to 28 °C. Allow the Meter to stabilize at room temperature prior to performing the accuracy tests.

Table 3 lists the required performance test points for verifying Meter accuracy. A zero adjustment must be performed prior to completing each performance test point.

Perform the tests as follows:

1. Connect a single loop of 14 gauge insulated copper wire to the calibrator **AUX** output terminals.
2. Clamp the Meter jaw around the wire with the jaw arrow pointing toward the calibrator **HI** terminal.
3. Output 0 mA dc from the calibrator.
4. Press **ZERO** on the Meter.
5. Set the calibrator output for the value in Step 1 of Table 3.
6. Compare the Meter displayed reading with the display reading limits in Table 3.
7. Complete steps 2-4 for each calibrator output setting in Table 3.
8. If the Meter fails to meet any of the Display Reading Limits, it requires calibration adjustment, or repair. See Calibration Adjustment or Contacting Fluke.

Table 3. Accuracy Tests

Step	Unit Under Test Function	Calibrator Output Setting	Unit Under Test Display Reading Limits	
			Lower Limit	Upper Limit
1.	mA dc	100 mA dc	98.5	101.5
2.		-100 mA dc	-100.7	-99.3
3.		20 mA dc	19.91	20.09
4.		-20 mA dc	-20.09	-19.91
5.		12 mA dc	11.93	12.07
6.		-12 mA dc	-12.07	-11.93
7.		4 mA dc	3.94	4.06
8.		-4 mA dc	-4.06	-3.94

Calibration Adjustment

Adjustment Subroutines

The Meter features closed-case calibration adjustment using a known reference source. The Meter measures the applied reference source, calculates correction factors, and stores the correction factors in nonvolatile memory.

There are four adjustment subroutines in the Meter adjustment procedure:

- Low Range (± 20 mA)
- High range (± 100 mA)
- Temperature
- Phase

Note

Temperature adjustment should always be performed prior to performing the other adjustment routines. The phase adjustment routine is ONLY required if the unit is repaired or the current clamp is replaced.

Front Panel Operation for Adjustment

Use a small probe to press the calibration button once to enter the Meter's calibration mode. The calibration button is usually covered by the factory calibration seal. A second press of the button saves new calibration constants and exits calibration mode. See Figure 4.

In calibration mode,  is used to select subroutines: low range, high range, temperature, or phase. A short press of  (<1 second) will toggle between low and high range subroutines. A long press (>1 second) will toggle between temperature and phase subroutines.

- Pressing **ZERO** is valid for all subroutines and normal operation. Pressing **ZERO** will zero the reading.
- In the low and high range subroutines, **HOLD** and  are used to adjust the negative and positive gain of the range.
- In the temperature subroutine, only **HOLD** is valid for adjustment.
- In the phase subroutine, **HOLD** and  are used to adjust the phase of two sensor-excitation signals by increasing or decreasing a parameter.

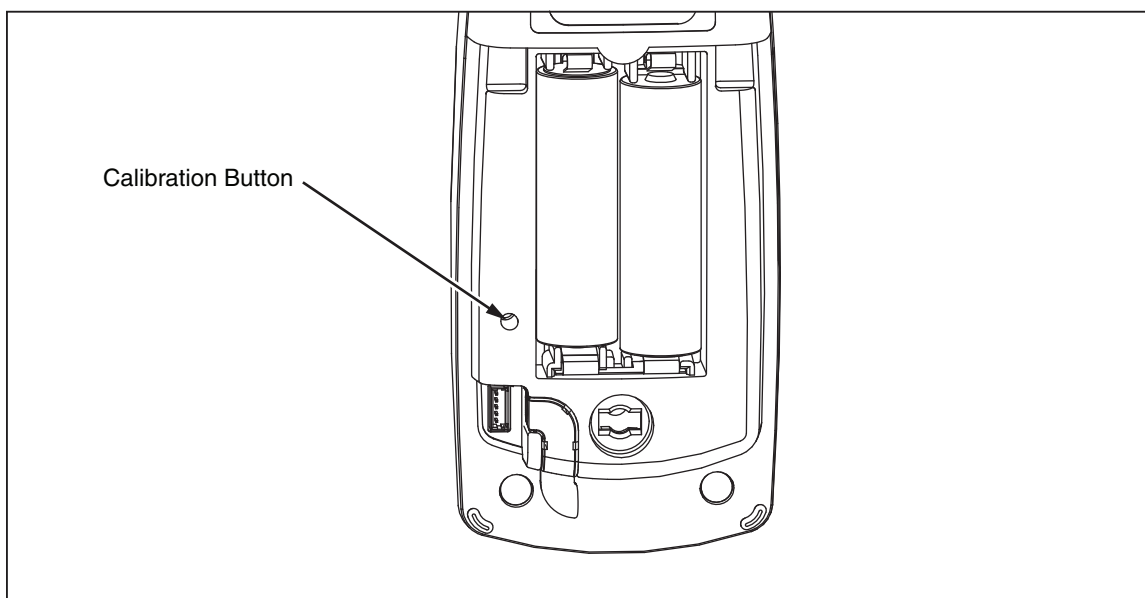


Figure 4. Accessing the Calibration Button

fdp3.eps

Calibration Error Messages

Table 4 lists the calibration error messages that can be shown on the Meter display. The suggested actions to eliminate messages are also listed.

Table 4. Error Messages

Error Message	Cause of Error	Suggested Action
CAL ERR1	The difference between the input level and the zero point is less than the minimal threshold when performing low range and high range adjustments.	Check current loop and ensure correct current is generated.
CAL ERR2	Calibration parameter checksum failure.	Execute all adjustments including temperature and phase.
CAL ERR3	Code checksum failure.	The Meter requires repair.

Calibration Adjustment Procedure

Allow the Meter to stabilize to room temperature before beginning the calibration adjustment.

To prepare for adjustment:

1. Remove the battery door and calibration seal.
2. Clamp the current loop in the current flow direction where required.
3. Turn the meter on and wait at least 10 seconds for warming up.
4. Press the hidden calibration button with a probe to enter calibration mode. See Figure 4.

Temperature Adjustment Procedure

1. Press  for >1 second until **t23** appears on the percentage display.
2. Wait at least 60 seconds for the internal temperature to balance.
3. Press **HOLD** to adjust the temperature.

Low Range Adjustment Procedure

1. Clamp the Meter's current clamp around an insulated 18 gauge, copper wire, with 6-inch diameter. Current flow should be in the direction of the arrow on the current clamp.
2. Press  < 1 second until **CAL 20** appears on percentage display.
3. Output 0 μ A dc from the calibrator.
4. Wait at least 15 seconds for the Meter's internal circuits to stabilize.
5. Press **ZERO** on the Meter to zero the reading.
6. Output 20 mA dc from the calibrator.
7. Wait at least 15 seconds for the Meter's internal circuits to stabilize.
8. Press  on the Meter to adjust the positive gain.
9. Output -20 mA dc from the calibrator.
10. Wait at least 15 seconds for the Meter's internal circuits to stabilize.
11. Press **HOLD** on the Meter to adjust the negative gain.

High Range Adjustment Procedure

1. Clamp the Meter's current clamp around an insulated 18 gauge, copper wire, with 6-inch diameter. Current flow should be in the direction of the arrow on the current clamp.
2. Press  < 1 second until **CAL 100** appears on percentage display.
3. Output 0 μ A dc from the calibrator.
4. Wait at least 15 seconds for the Meter's internal circuits to stabilize.
5. Press **ZERO** on the Meter to zero the reading.
6. Output 100 mA dc from the calibrator.
7. Wait at least 15 seconds for the Meter's internal circuits to stabilize.
8. Press  on the Meter to adjust the positive gain.
9. Output -100 mA dc from the calibrator.
10. Wait at least 15 seconds for the Meter's internal circuits to stabilize.
11. Press **HOLD** on the Meter to adjust the negative gain.

Note

The following procedure is not required unless the Meter's current clamp has been replaced.

Phase Adjustment Procedure

1. Clamp the Meter's current clamp around an insulated 18 gauge, copper wire, with 6-inch diameter. Current flow should be in the direction of the arrow on the current clamp.
2. Press $\odot$ >1 second until the percentage display indicates the Meter's currently saved phase value.
3. Output 0 μ A dc from the calibrator.
4. Press **ZERO** on the Meter to zero the reading.
5. Rotate the Meter's clamp around the current loop conductor and record the minimum and maximum values of the Meter's display reading. See Figure 5.
6. Use $\odot$ and **HOLD**, to adjust the difference between the minimum and maximum value recorded in Step 5, until the reading difference is less than 0.05 mA.

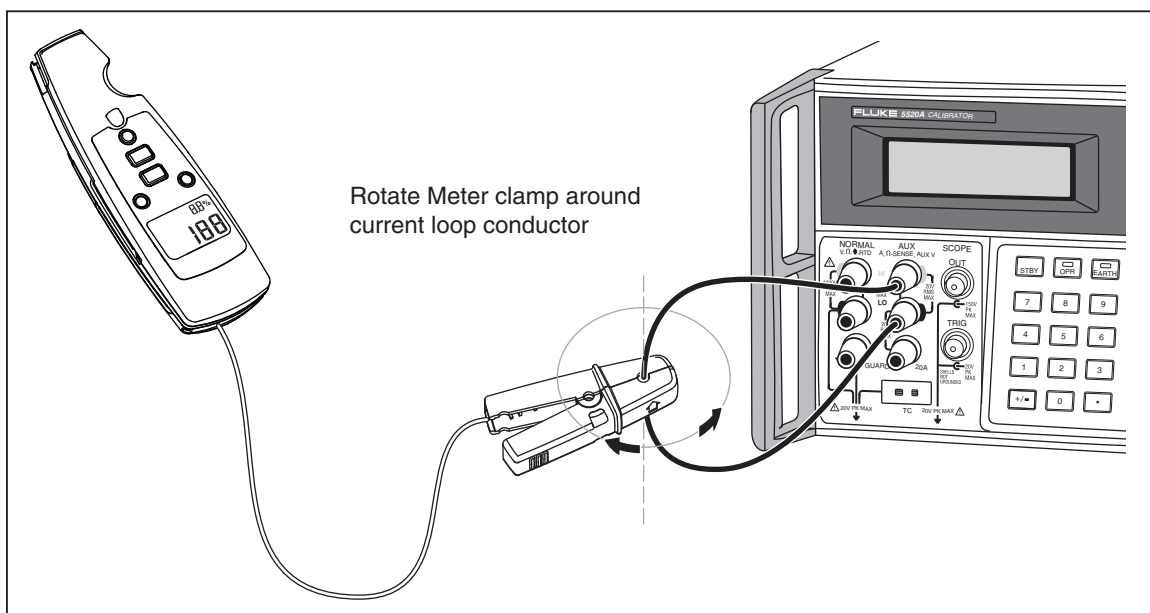


Figure 5. Phase Adjustment

fdp5.eps

User Replaceable Parts

Table 5 and Figure 6 list all user replaceable parts.

Table 5. Replaceable Parts

Item ID	Description	P/N	Qty
①	Decal	2723063	1
②	Case top assembly (does not include decal, order separately)	2720362	1
③	Keypad	2723056	1
④	Jaw assembly (Includes cable)	2722971	1
⑤	Screw,m2.2x0.8,8mm,pan,phillips,steel,zinc-black chromate, thread form	1991287	2
⑥	Case, bottom (does not include battery contact, order separately)	2720285	1
⑦	Cable cleat	2720328	1
⑧	Screw,4-14,.375,pan,phillips,steel, zinc-black chromate, thread form	2800097	2
⑨	Battery contact, dual	666435	1
⑩	Screw,m3,13.5mm,pan,phillips,steel,zinc-black chromate, thread form	2388412	2
⑪	Battery,primary,mno2-zn,1.5v,2.24ah,15a,Ir6,alkaline,aa,14x50mm,bulk	376756	2
⑫	Battery pad,urethane,adhesive-back,20.0mm l,20.0mm w,5.0mm thk	2687457	1
⑬	Battery door (does not include fastener, order separately)	2720304	1
⑭	Access door fastener	948609	1
⑮	LED housing	2720319	1
-	Soft case, black/yellow	2726174	1
-	771 Instruction Sheet	2567301	1

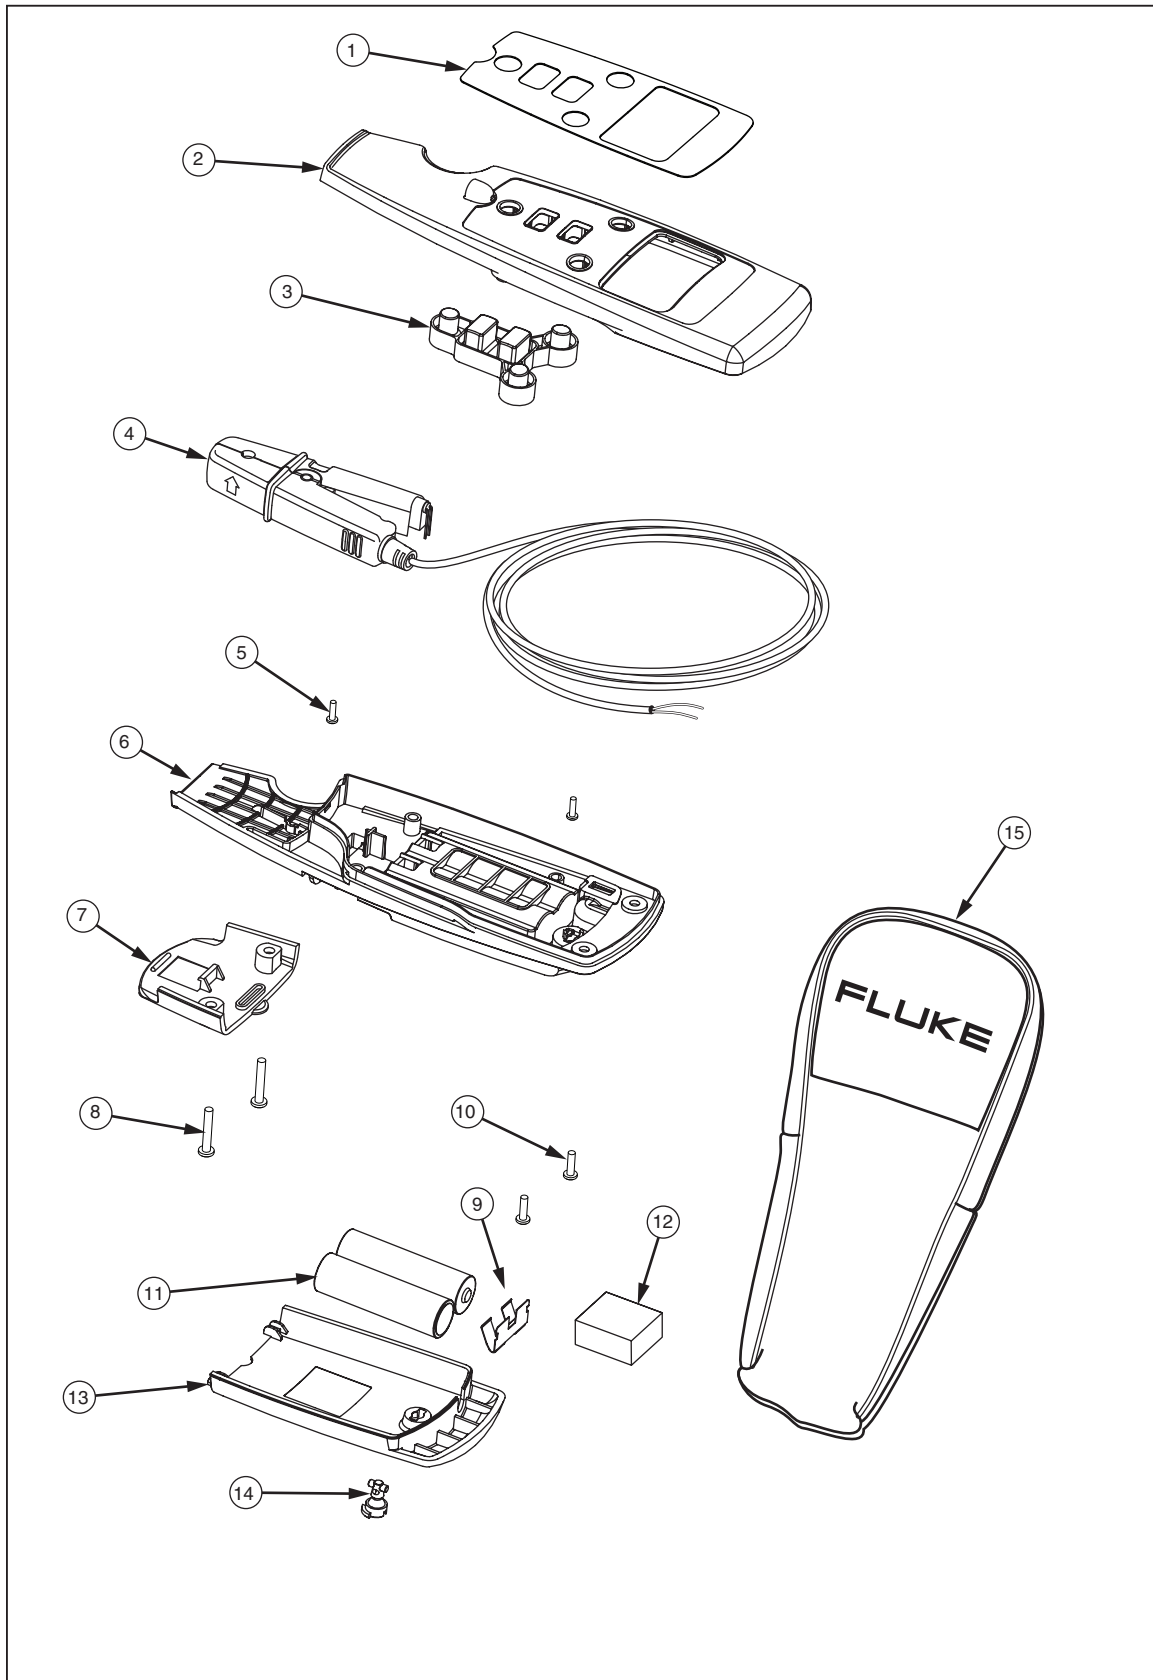


Figure 6. Replaceable Parts

fdp4.eps